

## **Foreward**

ASBESTOS SURVEY REPORT FOR CROFTWAY ACADEMY, WILLIAM STREET, BLYTH, NE24 2HP.

I have enclosed for your information and retention the most recent asbestos survey (Management) which applies to the property stated above. The purpose of the survey is to identify as far as possible, the materials containing asbestos fibres in your property.

The attached report is divided in sections so as to give as much information as possible, a basic reference section for use by premises managers and a more detailed report for use by contractors on site etc.

### **Plan of the Building and Sample Locations**

This contains a plan of the building and identifies where asbestos samples have been taken from.

### **Photographs of Areas Sampled**

This section contains photographs of all the areas where samples were taken. These photographs can be used when carrying out the periodic inspections to see if there has been any change or deterioration in its condition.

### **Survey Information**

This section contains the survey information as printed from the central database held at Land and Property. It describes the type of asbestos present, its location, condition etc. Contractors should be shown this section along with the others when they are shown the register prior to starting any work.

### **Priority Risk Assessments**

This section contains assessments which have been created using information from the survey and information on your property. This assessment helps to determine how often periodic checks on any asbestos need to be carried out by your Samo.

### **5 Simple Steps to Asbestos Management**

This section details procedures for managing asbestos in your property. It gives guidance on the register, the inspections, any planned work and what to do when contractors arrive on site.

### **Commonly asked Questions**

This section covers questions most commonly asked and can be referred to as/when the need arises.

The building has been surveyed as comprehensively as possible, all potentially fibrous materials have been examined and where necessary analysed by competent UKAS accredited analysts and the findings of both recorded in the report.

This report is an important document and must be referred to before any building works are carried out. The report must be kept with your handbook and the checklists completed on a regular basis. You will be reminded when your specific checklists are due for submission.

### **Information for Employees Working in Premises where Asbestos Containing Materials Exist.**

Asbestos is made up of fibrous materials, which are flexible, mechanically strong and resistant to stretching, heat and chemicals. As a consequence asbestos has been used extensively in buildings. Examples of asbestos containing materials found in buildings include exterior asbestos cement cladding; gutters and pipes; fireproof sprays on structural steel joists; insulation boards in service ducts and wall partitions; ceiling and floor tiles and pipe and boiler lagging.

Asbestos containing products can produce very small fibrous dust particles, which can not be seen by the naked eye. It is only when these fibres become airborne, due to damage, deterioration, disturbance etc, that there is a risk to health.

### **If asbestos is maintained in good condition and is not disturbed or damaged it does not pose a health risk.**

The authority has a management system for ensuring that you are not exposed to asbestos containing materials that are in poor condition and may pose a health risk. This system is based on sound principals laid down by legislation and associated codes of practice and guidance.

It is not appropriate simply to remove all asbestos containing materials in buildings. Asbestos materials that are sound, undamaged and not releasing dust should be left alone. Any disturbance to such materials, however carefully controlled, will release fibres and be counter-productive.

Within the building you occupy, your department has nominated a Site Asbestos Monitoring Officer (SAMO). This individual is responsible for inspecting the asbestos containing materials to ensure they are not in a dangerous condition. Should you have any concerns about suspect materials within your premises you should contact the SAMO.

### **Restrictions on use, distribution and publication of the report**

We accept no responsibility or liability for the consequences of this document being used for purpose other than for which it was commissioned.

To the extent that the document is based on the information available at the time of writing, Sunderland City Council accepts no liability for any consequences should this report be used for any other purpose

If you require any further information regarding the report or its application please contact Caroline Bage, Asbestos Manager on Tel: 07557 938966.

Yours sincerely,

Neil Guthrie  
Director of Development and Property

Sunderland  
City Council

# Sunderland City Council

*Control of Asbestos  
Regulations 2012*

## **Asbestos Register for Croftway Academy, William Street, Blyth. NE24 2HP**



**UPRN: - 348056**

**TF Ref:**

**Location of register:-**

**Premises Manager / Samo: - Tenant**

**Date: 06 March 2026**

**Contact Numbers List: -**

**Caroline Bage Asbestos Manager – 07557 938966**

## Contents

	<u>Section</u>
• Plan of building and sample locations	1
• Photographs of areas sampled	2
• Survey information	3
• Asbestos Management Plan, Priority Assessments,	4
• Contacts Form, Code of Practice	4
• 5 Simple Steps of Asbestos Management	5
• Commonly asked questions	6

## Appendices

• Form 1 – Visitor Register	7
• Form 2 – Periodic Return Checklist and Schedule	8
• Form 3 – Works Notification Form	9
• Form 4 – Registration of All Disturbances	10
• Form 5 – Training Records	11

## Plan of Building and Samples Location

- (Item 1) Ref: 348056-4 – Pipe lagging (Boiler room-access from hatch in 0/027 - Rm -1/01) – No Risk
- (Item 2) Ref: 348056-5 – Pipework flange gasket (Boiler room-access from hatch in 0/027 - Rm -1/01) – Low Risk
- (Item 3) As 348056-5 – Loose lying gasket (Boiler room-access from hatch in 0/027 - Rm -1/01) – Low Risk
- (Item 4) Ref: 348056-6 – Break pads - (Boiler room-access from hatch in 0/027 - Rm -1/01) – No Risk
- (Item 5) Ref: 348056-1 – Floor screed (Cleaners store Rm 0/02) – No Risk
- (Item 6) Ref: 348056-2 – Gasket to underside of sink (Cloakroom Rm 0/04) – No Risk
- (Item 7) Ref: 348056-3 – Packers to skylight surrounds (WC-void above Rm 0/05) – No Risk
- (Item 8) Ref: As 348056-3 – Packers to skylight surrounds (WC-void above Rm 0/06) – No Risk
- (Item 9) Ref: As 348056-3 – Packers to skylight surrounds (Boys WC-void above Rm 0/013) – No Risk
- (Item 10) Ref: 348056-7 – Debris to walls (WC-void above Rm 0/045) – Medium Risk
- (Item 11) Ref: 348056-8 – Mastic to windows above fire exit door (externals) – No Risk
- (Item 12) Ref: 348056-9 – Mastic to down pipe collars (externals) – No Risk
- (Item 13) Ref: 355899-1 – Sink Pad (Caretakers House Kitchen/Rm 0/005) – No Risk
- (Item 14) Ref: 355899-2 – Flat Roof (Caretakers House/External) – No Risk
- (Item 15) Ref: 21-35349-1 - Flange to gas pipe (Gaskets) (Room/Area: 2 - Sports hall boiler room) – No Risk
- (Item 16) Ref: 21-35349-2 - Pipe flanges to water heating pipes (Gaskets) (Room/Area: 2 - Sports hall boiler room) – No Risk
- (Item 17) Ref: 21-35349-3 - Redundant textile pipe wrap to floor (Textile) (Room/Area: 2 - Sports hall boiler room) – No Risk
- (Item 18) Ref: 21-36876-1 – Ceiling tiles above suspended ceiling (Area 5/Girls Toilet) – No Risk
- (Item 19) Ref: 21-36876-2 – Bitumen packers and residue around skylights (Area 5/Girls Toilet) – No Risk
- (Item 20) Ref: 21-36876-1 – Ceiling tiles above suspended ceiling (Area 6/WC) – No Risk
- (Item 21) Ref: 21-36876-2 – Bitumen packers and residue around skylights (Area 6/WC) – No Risk
- (Item 22) Ref: 21-36876-1 – Ceiling tiles above suspended ceiling (Area 15/Boys Toilet) – No Risk
- (Item 23) Ref: 21-36876-2 – Bitumen packers and residue around skylights (Area 15/Boys Toilet) – No Risk
- (Item 24) Ref: 21-36876-3 - Textured coating to repaired patch (Area 16/Learning Space) – No Risk
- (Item 25) Ref: 21-36876-4 – Remnants of previous suspended ceiling tiles (Area 26/Library) – No Risk

- (Item 26) Ref: 21-36876-5 – Insulating residue to ceiling joists (Area 43/Nursery Boys Toilet) – Low Risk
- (Item 27) Ref: 21-36876-5 - Insulating residue to walls (Area 43/Nursery Boys Toilet) – Low Risk
- (Item 28) Ref: 21-36876-6 – Bitumen residue from roof on ceiling (Area 43/Nursery Boys Toilet) – No Risk
- (Item 29) Ref: 21-36876-7 – Insulating board residue to walls (Area 47/Nursery Girls Toilet) – No Risk
- (Item 30) Ref: Presumed – Textile – Electric Meter (Entrance Lobby G/01) – Low Risk
- (Item 31) Ref: HD000490 – Bitumen overspill to timber beams – ceiling void (Toilet 006) – No Risk
- (Item 32) Ref: As HD000490 – Bitumen overspill to timber beams above fibre board ceiling – ceiling void (Toilet 013) – No Risk
- (Item 33) Ref: As HD000490 – Bitumen overspill walls – ceiling void (Toilet 045) – No Risk
- (Item 34) Ref: As HD000490 – Bitumen overspill walls – ceiling void (Toilet 052) – No Risk

**Please note the survey carried out was non-intrusive and any areas not listed above may not have been accessed or had samples taken, should major refurbishment be planned for the property, further investigation will be required.**

Limited/No access - further investigation will be required prior to works in these areas:

- 1) Boiler Room (access from hatch in 0/027) -1/01 – Limited access - excessive storage preventing full survey to all areas
- 2) Boiler Room (access from hatch in 0/027) -1/01 – 3 no. boilers - Limited access – live service supply
- 3) Boiler Room (access from hatch in 0/027) -1/01 – electrics - no access – live service supply
- 4) Office-loft space Rm 0/016 – limited access – physically restricted space
- 5) Hall-loft space Rm 0/018 – no access – reasons of height – platform required
- 6) Office-void above Rm 0/027 – no access – underside of roof - excessive layers of insulation preventing view of the underside of roof
- 7) Office-void above Rm 0/028 – no access – underside of roof - excessive layers of insulation preventing view of the underside of roof
- 8) Office-void above Rm 0/031 – no access – underside of roof - excessive layers of insulation preventing view of the underside of roof
- 9) Lobby-void above Rm 0/032 – no access – underside of roof - excessive layers of insulation preventing view of the underside of roof
- 10) Staff room-void above Rm 0/033 – no access – underside of roof - excessive layers of insulation preventing view of the underside of roof
- 11) Classroom Rm 0/038 – Metal flue within plasterboard boxing – limited access – seen from ceiling void – damage to boxing to survey the bottom
- 12) Shared resource area Rm 0/044 – Void above loft hatches – no access – reasons of height – platform required
- 13) Loft spaces above classrooms to pitched roof areas – no access – physically restricted space and reasons of height
- 14) Externals – chimneys and cowls – no access – reasons of height

## Photographs of Areas Sampled



### **Item 1 Ref: 348056-4**

The pipe lagging (Boiler room-access from hatch in 0/027 - Rm -1/01) does not contain asbestos.



### **Item 2 Ref: 348056-5**

The pipework flange gasket (Boiler room-access from hatch in 0/027 - Rm -1/01) contains asbestos.

Any change in appearance should be reported to Property Services.



### **Item 3 Ref: As 348056-5**

The loose lying gasket (Boiler room-access from hatch in 0/027 - Rm -1/01) contains asbestos.

Any change in appearance should be reported to Property Services.

## Photographs of Areas Sampled continued



### **Item 4 Ref: 348056-6**

The break pads - (Boiler room - access from hatch in 0/027 - Rm -1/01) does not contain asbestos.



### **Item 5 Ref: 348056-1**

The floor screed (Cleaners store Rm 0/02) does not contain asbestos.



### **Item 6 Ref: 348056-2**

The gasket to underside of sink (Cloakroom Rm 0/04) does not contain asbestos.

**Photographs of Areas Sampled continued**



**Item 7 Ref: 348056-3**

The packers to skylight surrounds (WC-void above Rm 0/05) do not contain asbestos.



**Item 8 Ref: As 348056-3**

The packers to skylight surrounds (WC-void above Rm 0/06) do not contain asbestos.



**Item 9 Ref: As 348056-3**

The packers to skylight surrounds (Boys WC-void above Rm 0/013) do not contain asbestos.

## Photographs of Areas Sampled continued



### **Item 10 Ref: 348056-7**

The Debris to walls (WC-void above Rm 0/045) contains asbestos.

Any change in appearance should be reported to Property Services.



### **Item 11 Ref: 348056-8**

The mastic to windows above fire exit door (externals) does not contain asbestos.



### **Item 12 Ref: 348056-9**

The mastic to down pipe collars (externals) does not contain asbestos.

**Photographs of Areas Sampled continued**



**Item 13 Ref: 355899-1**

The sink pad in the kitchen in the caretakers house (Room 0/005) does not contain asbestos.

NO PHOTOGRAPH PROVIDED

**Item 14 Ref: 355899-2**

The flat roof to the caretakers house (externals) does not contain asbestos.



**Item 15 Ref: 21-35349-1**

The flange to gas pipe (Gaskets) (Room/Area: 2 - Sports hall boiler room) does not contain asbestos.

## Photographs of Areas Sampled continued

### **Item 16 Ref: 21-35349-2**



The pipe flanges to water heating pipes (Gaskets) (Room/Area: 2 - Sports hall boiler room) do not contain asbestos.

### **Item 17 Ref: 21-35349-3**



The redundant textile pipe wrap to floor (Textile) (Room/Area: 2 - Sports hall boiler room) does not contain asbestos.

### **Item 18 Ref: 21-36876-1**



The ceiling tiles above suspended ceiling in Girls Toilet (Area 5) does not contain asbestos.

**Photographs of Areas Sampled continued**



**Item 19 Ref: 21-36876-2**

The bitumen packers and residue around skylights in Girls Toilet (Area 5) does not contain asbestos.



**Item 20 Ref: 21-36876-1**

The ceiling tiles above suspended ceiling in WC (Area 6) does not contain asbestos.



**Item 21 Ref: 21-36876-2**

The bitumen packers and residue around skylights in WC (Area 6) does not contain asbestos.

## Photographs of Areas Sampled continued



### **Item 22 Ref: 21-36876-1**

The ceiling tiles above suspended ceiling in Boys Toilet (Area 15) does not contain asbestos.



### **Item 23 Ref: 21-36876-2**

The bitumen packers and residue around skylights in Boys Toilet (Area 15) does not contain asbestos.



### **Item 24 Ref: 21-36876-3**

The textured coating to repaired patch of ceiling in Learning Space (Area 16) does not contain asbestos.

## Photographs of Areas Sampled continued



### **Item 25 Ref: 21-36876-4**

The remnants of previous suspended ceiling tiles in Library (Area 26) does not contain asbestos.



### **Item 26 Ref: 21-36876-5**

The insulating board residue to joists in Nursery Boys Toilet (Area 43) does contain asbestos.

Any change in appearance should be reported to Property Services.



### **Item 27 Ref: 21-36876-5**

The insulating board residue to joists in Nursery Boys Toilet (Area 43) does contain asbestos.

Any change in appearance should be reported to Property Services.

**Photographs of Areas Sampled continued**



**Item 28 Ref: 21-36876-6**

The bitumen residue from roof in Nursery Boys Toilet (Area 43) does not contain asbestos.



**Item 29 Ref: 21-36876-7**

The insulating board residue in Nursery Girls Toilet (Area 47) does not contain asbestos.



**Item 30 Ref: Presumed**

The textiles in the electric meter (Entrance Lobby G/01) are presumed to contain asbestos.

Any change in appearance should be reported to Property Services.

**Photographs of Areas Sampled continued**



**Item 31 Ref: HD000490**

The bitumen overspill to timber beams in the ceiling void (Toilets G/06) does not contain asbestos.



**Item 32 Ref: As HD000490**

The bitumen overspill to timber beams above fibroboard ceiling in the ceiling void (Toilets G/13) does not contain asbestos.



**Item 33 Ref: As HD000490**

The bitumen overspill to walls in the ceiling void (Toilets G/45) does not contain asbestos.

**Photographs of Areas Sampled continued**



**Item 34 Ref: As HD000490**

The bitumen overspill to walls in the ceiling void (Toilets G/52) does not contain asbestos.

Sunderland  
City Council

## Five Simple Steps to Asbestos Management

Each property has a nominated site asbestos monitoring officer (SAMO). The SAMO is responsible for maintaining this register and ensuring all necessary personnel are aware of the register including all maintenance, construction and service installers; undertaking periodic inspections and liaising with the Departmental Asbestos Co-ordinator and the Asbestos Manager in Property Services as necessary.

The SAMO's role is very important but this guide is hoped to ensure the requirements are easy and simple to follow.

### Step 1 – Receiving the Register

The SAMO is the tenant.

And the person is responsible for the register, where it is located and that it is kept up to date.

The register contains a plan of the premises and a photographic schedule of where the asbestos is and what risk is associated.

The SAMO must make all employees aware of the locations and should let any contractors entering the building view the register before any work is started.

### Step 2 – Periodic Inspections

The SAMO must look at the locations photographed and compare the asbestos now to when the photograph was taken and complete the checklist attached (Form 2).

The checklists are to be completed periodically in accordance with the schedule attached.

Should the SAMO come across some asbestos which has been disturbed, whether during refurbishment works or during the normal course of wear and tear, they should complete Form 4 as far as possible and contact Property Services for advice and remedial action.

In the meantime, they should ensure that access to the area containing the disturbed or damaged asbestos is prohibited until Property Services has made recommendations.

### Step 3 – Planned Work

All planned works that may disturb or danger any asbestos indicated, should be reported to Property Services using form 3 at least 21 days before the work is due to commence.

#### Step 4 – Contractors on Site

If a contractor arrives on site, the SAMO must :

- a. Make sure they read/view the register
- b. Get contractor to sign register to say he has read it (Form1).
- c. Get confirmation from the contractor that proposed works will not disturb any asbestos areas.
- d. If area is disturbed that was not identified in Register, advise Property Services immediately and complete Form 4.

#### Step 5 – Monitoring the Register

On completion of work get contractor to sign to say they didn't disturb any areas.

If alterations have occurred details should be forwarded to Property Services.

If you, as SAMO, are to leave your post, please notify your Departmental Co-ordinator to appoint another person and notify Property Services and the front of your register.

In the event of an exposure of asbestos, please refer to your site specific emergency procedures. However, as a minimum:

- Seal the area off completely. (Lock the area off if possible and post a notice on the door, "No access - Contact ..... " )
- If there is any air movement systems within the premises, shut it off.
- Contact the Asbestos Manager on 07557938966 immediately. Who will arrange for any remedial works / air monitoring.
- Start to complete the "Registration of Disturbances" form, which is in your register (Section 10 in the new style register).

Once the remedial works have been carried out and a clear air test certificate has been issued. Access to the area can be re-opened.

In the event that you are unable to contact the Asbestos Manager, please contact the Civic Centre on 520 5555 and ask for assistance from a building surveyor. Out of hours ring the City Alarm and Emergency Control room on 553 1999.

Central Safety can be contacted on 561 2311.

**In the event of a fire (or drill), the asbestos register must be taken outside to show the emergency services.**

## Commonly Asked Questions.

- **How often should SAMO's undertake inspections of asbestos containing materials?**  
The Asbestos Manager will inform the SAMO of how often the inspections should be undertaken.
- **What should a SAMO do if the asbestos containing materials are disturbed or damaged?**  
The SAMO should prohibit access to the areas until the Asbestos Manager in Property Services has been contacted and given recommendations.
- **Can employees put up decorations onto asbestos containing materials?**  
No decorations should be attached to asbestos containing materials. However, it is understood that some decoration is already attached to asbestos containing materials and these should be left in place.
- **Can a room with asbestos containing materials in the ceiling and wall be painted?**  
Yes, as long as the material is not rubbed or sanded down, as this may result in the release of asbestos fibres.
- **Why isn't all asbestos containing materials removed from buildings?**  
Because it is safer to leave asbestos containing materials in good condition in buildings. Removing the materials will result in a greater risk to health because of the consequential release of fibres.
- **When will asbestos containing material be removed from my building?**  
Asbestos containing materials will be removed if work involves the disturbance of the material e.g. during the refurbishment or dismantling of part of the building or structure.
- **What should a SAMO do if he/she has had no training in use of the register?**  
The SAMO should ring the Departmental Co-ordinator who will arrange training.

**Form 2**Inspection Schedule

Picture	Location	Risk	Inspection Frequency	Date of return
<i>Item 1</i>	<i>No asbestos</i>	<i>Is present</i>		
<b>Item 2</b>	<b>Pipework flange gasket (Boiler room-access from hatch in 0/027 - Rm -1/01)</b>	<b>Low Risk</b>	<b>12 monthly by analyst</b>	<b>29/01/2027</b>
<b>Item 3</b>	<b>Loose lying gasket (Boiler room-access from hatch in 0/027 - Rm - 1/01)</b>	<b>Low Risk</b>	<b>12 monthly by analyst</b>	<b>29/01/2027</b>
<i>Item 4</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 5</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 6</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 7</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 8</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 9</i>	<i>No asbestos</i>	<i>Is present</i>		
<b>Item 10</b>	<b>Debris to walls (WC-void above Rm 0/045)</b>	<b>Medium Risk</b>	<b>12 monthly by analyst</b>	<b>29/01/2027</b>
<i>Item 11</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 12</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 13</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 14</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 15</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 16</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 17</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 18</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 19</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 20</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 21</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 22</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 23</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 24</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 25</i>	<i>No asbestos</i>	<i>Is present</i>		
<b>Item 26</b>	<b>Insulating</b>	<b>Low Risk</b>	<b>12 monthly by</b>	<b>29/01/2027</b>

	<b>residue to ceiling joists (Area 43/Nursery Boys Toilet)</b>		<b>analyst</b>	
<b>Item 27</b>	<b>Insulating residue to walls (Area 43/Nursery Boys Toilet)</b>	<b>Low Risk</b>	<b>12 monthly by analyst</b>	<b>29/01/2027</b>
<i>Item 28</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 29</i>	<i>No asbestos</i>	<i>Is present</i>		
<b>Item 30</b>	<b>Textile – Electric Meter (Entrance Lobby G/01)</b>	<b>Low Risk</b>	<b>12 monthly</b>	<b>29/01/2027</b>
<i>Item 31</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 32</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 33</i>	<i>No asbestos</i>	<i>Is present</i>		
<i>Item 34</i>	<i>No asbestos</i>	<i>Is present</i>		

**Form 2**


Periodic Return

<b>School/Site</b>	
<b>Date of Inspection</b>	
<b>Inspection By (signature)</b>	
<b>Print Name</b>	

**Good Practice Guidance:**

- Take photographs of ACMs for each inspection and store for future reference
- Compare previous photographs with current condition state to determine whether there has been any deterioration since the last inspection
- Replace missing/damaged asbestos labels/stickers

Ref: Condition                      Action Required                      Asbestos Stickers                      Comments  
         Same/change                      Yes/No                      Displayed Y/N

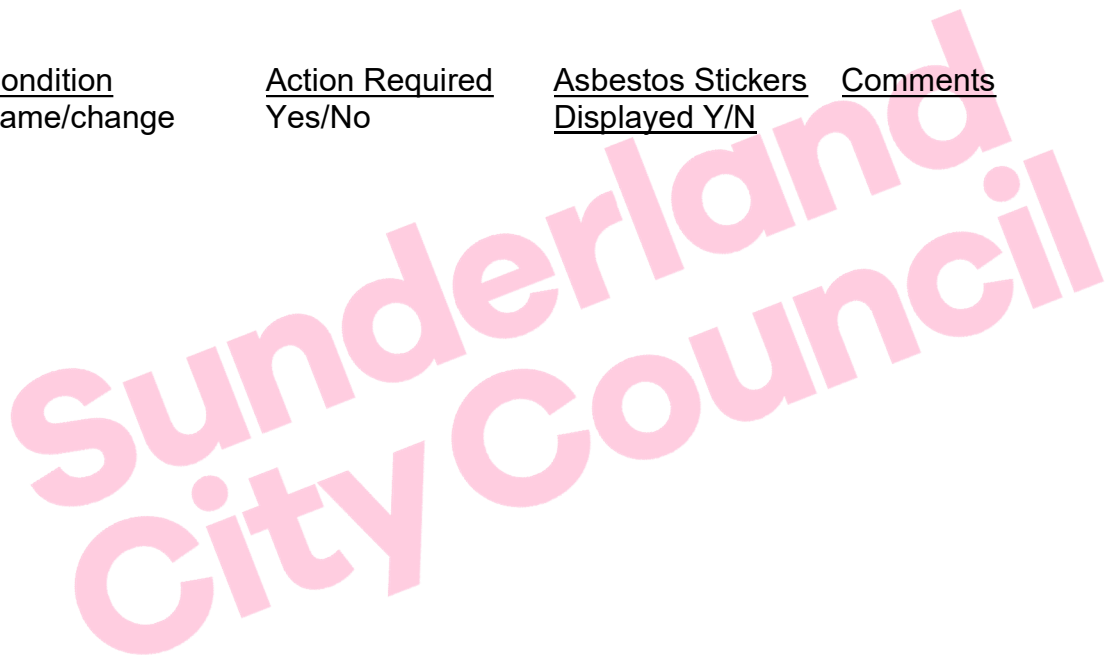

**For Office Use Only**

<b>Actions Required</b>	
<b>Actions Completed</b>	
<b>Alterations to Register</b>	